



DANGER

Danger of electrical shock, burns or death. Always remove all power sources before attempting any repair, service or diagnostic work. Power can be present from shore power, generator, inverter or battery. All power sources must be disabled and secured before performing any service.




CAUTION

If you lack the skills, tools or equipment to perform diagnostic or repair work leave such work to an authorized Winnebago Industries dealer or other qualified shop.

RELEASE	REV A	DATE	OFTR	ADM	DOC NO	134838
REV	ZONE	REVISION RECORD			DATE	OFTR-OR



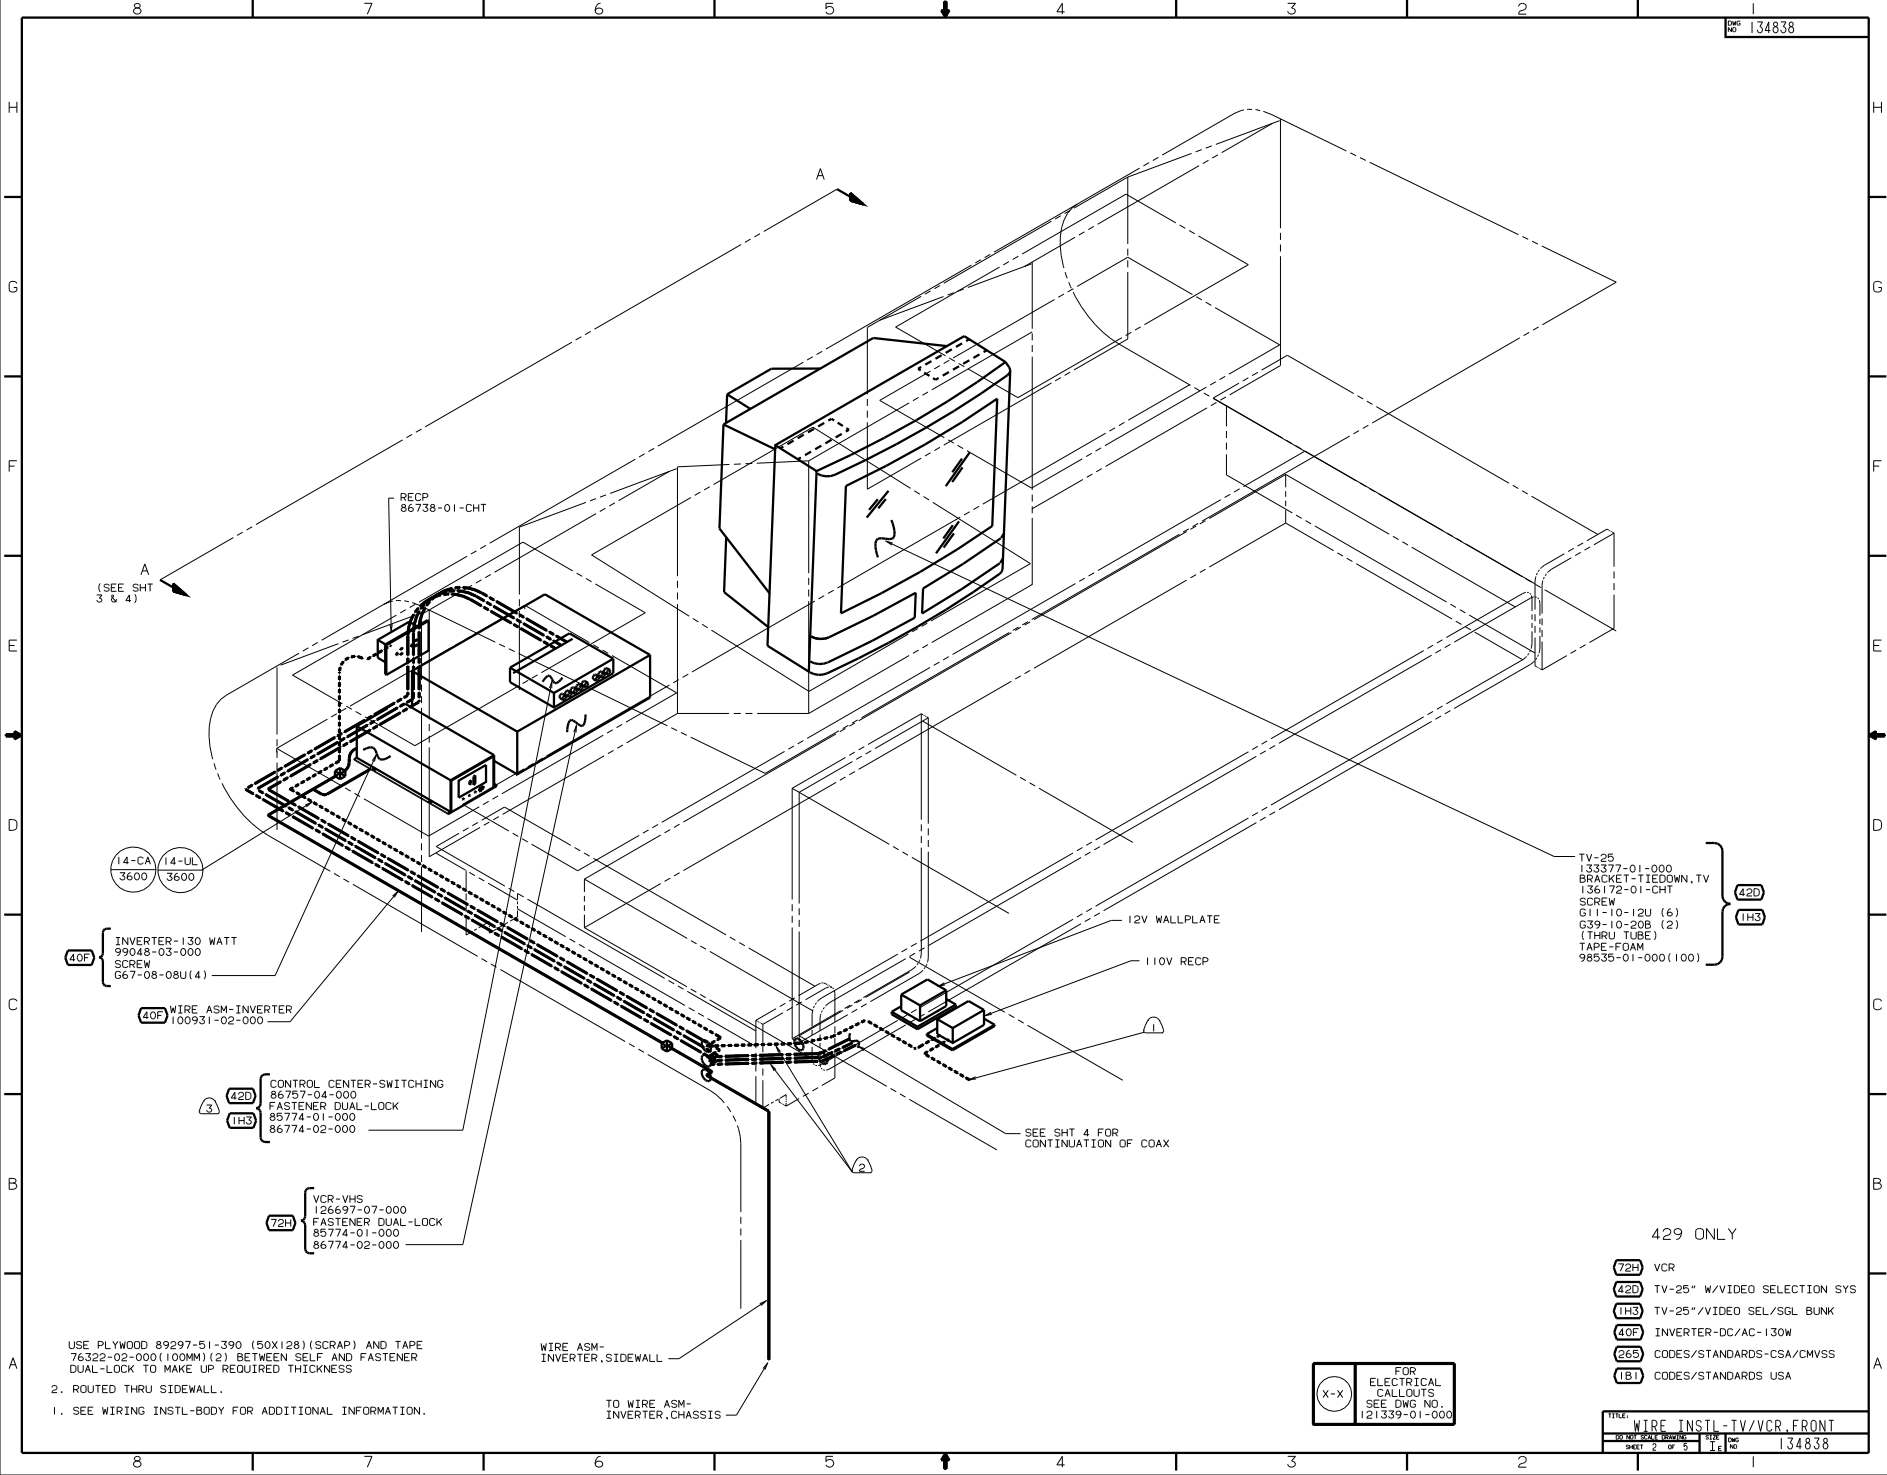

14-CA 3600 14-UL 3600

40F INVERTER-130 WATT
99048-03-000
SCREW
667-08-08U(4)

40F WIRE ASM-INVERTER
100931-02-000

42D CONTROL CENTER-SWITCHING
86757-04-000
1H3 FASTENER DUAL-LOCK
85774-01-000
86774-02-000

72H VCR-VHS
126697-07-000
FASTENER DUAL-LOCK
85774-01-000
86774-02-000

TV-25
133377-01-000
BRACKET-TIEDOWN, TV
136172-01-CHT
SCREW
G11-10-12U (6)
G39-10-20B (2)
(THRU TUBE)
TAPE-FOAM
98535-01-000 (100)

12V WALLPLATE

110V RECP

SEE SHT 4 FOR
CONTINUATION OF COAX

WIRE ASM-
INVERTER, SIDEWALL

TO WIRE ASM-
INVERTER, CHASSIS

USE PLYWOOD 89297-51-390 (50X128) (SCRAP) AND TAPE
76322-02-000(100MM) (2) BETWEEN SELF AND FASTENER
DUAL-LOCK TO MAKE UP REQUIRED THICKNESS


2. ROUTED THRU SIDEWALL.

1. SEE WIRING INSTL-BODY FOR ADDITIONAL INFORMATION.

FOR
ELECTRICAL
CALLOUTS
SEE DWG NO.
121339-01-000

429 ONLY

- 72H VCR
- 42D TV-25" W/VIDEO SELECTION SYS
- 1H3 TV-25" VIDEO SEL/SQL BUNK
- 40F INVERTER-DC/AC-130W
- 265 CODES/STANDARDS-CSA/CMVSS
- 1B1 CODES/STANDARDS USA

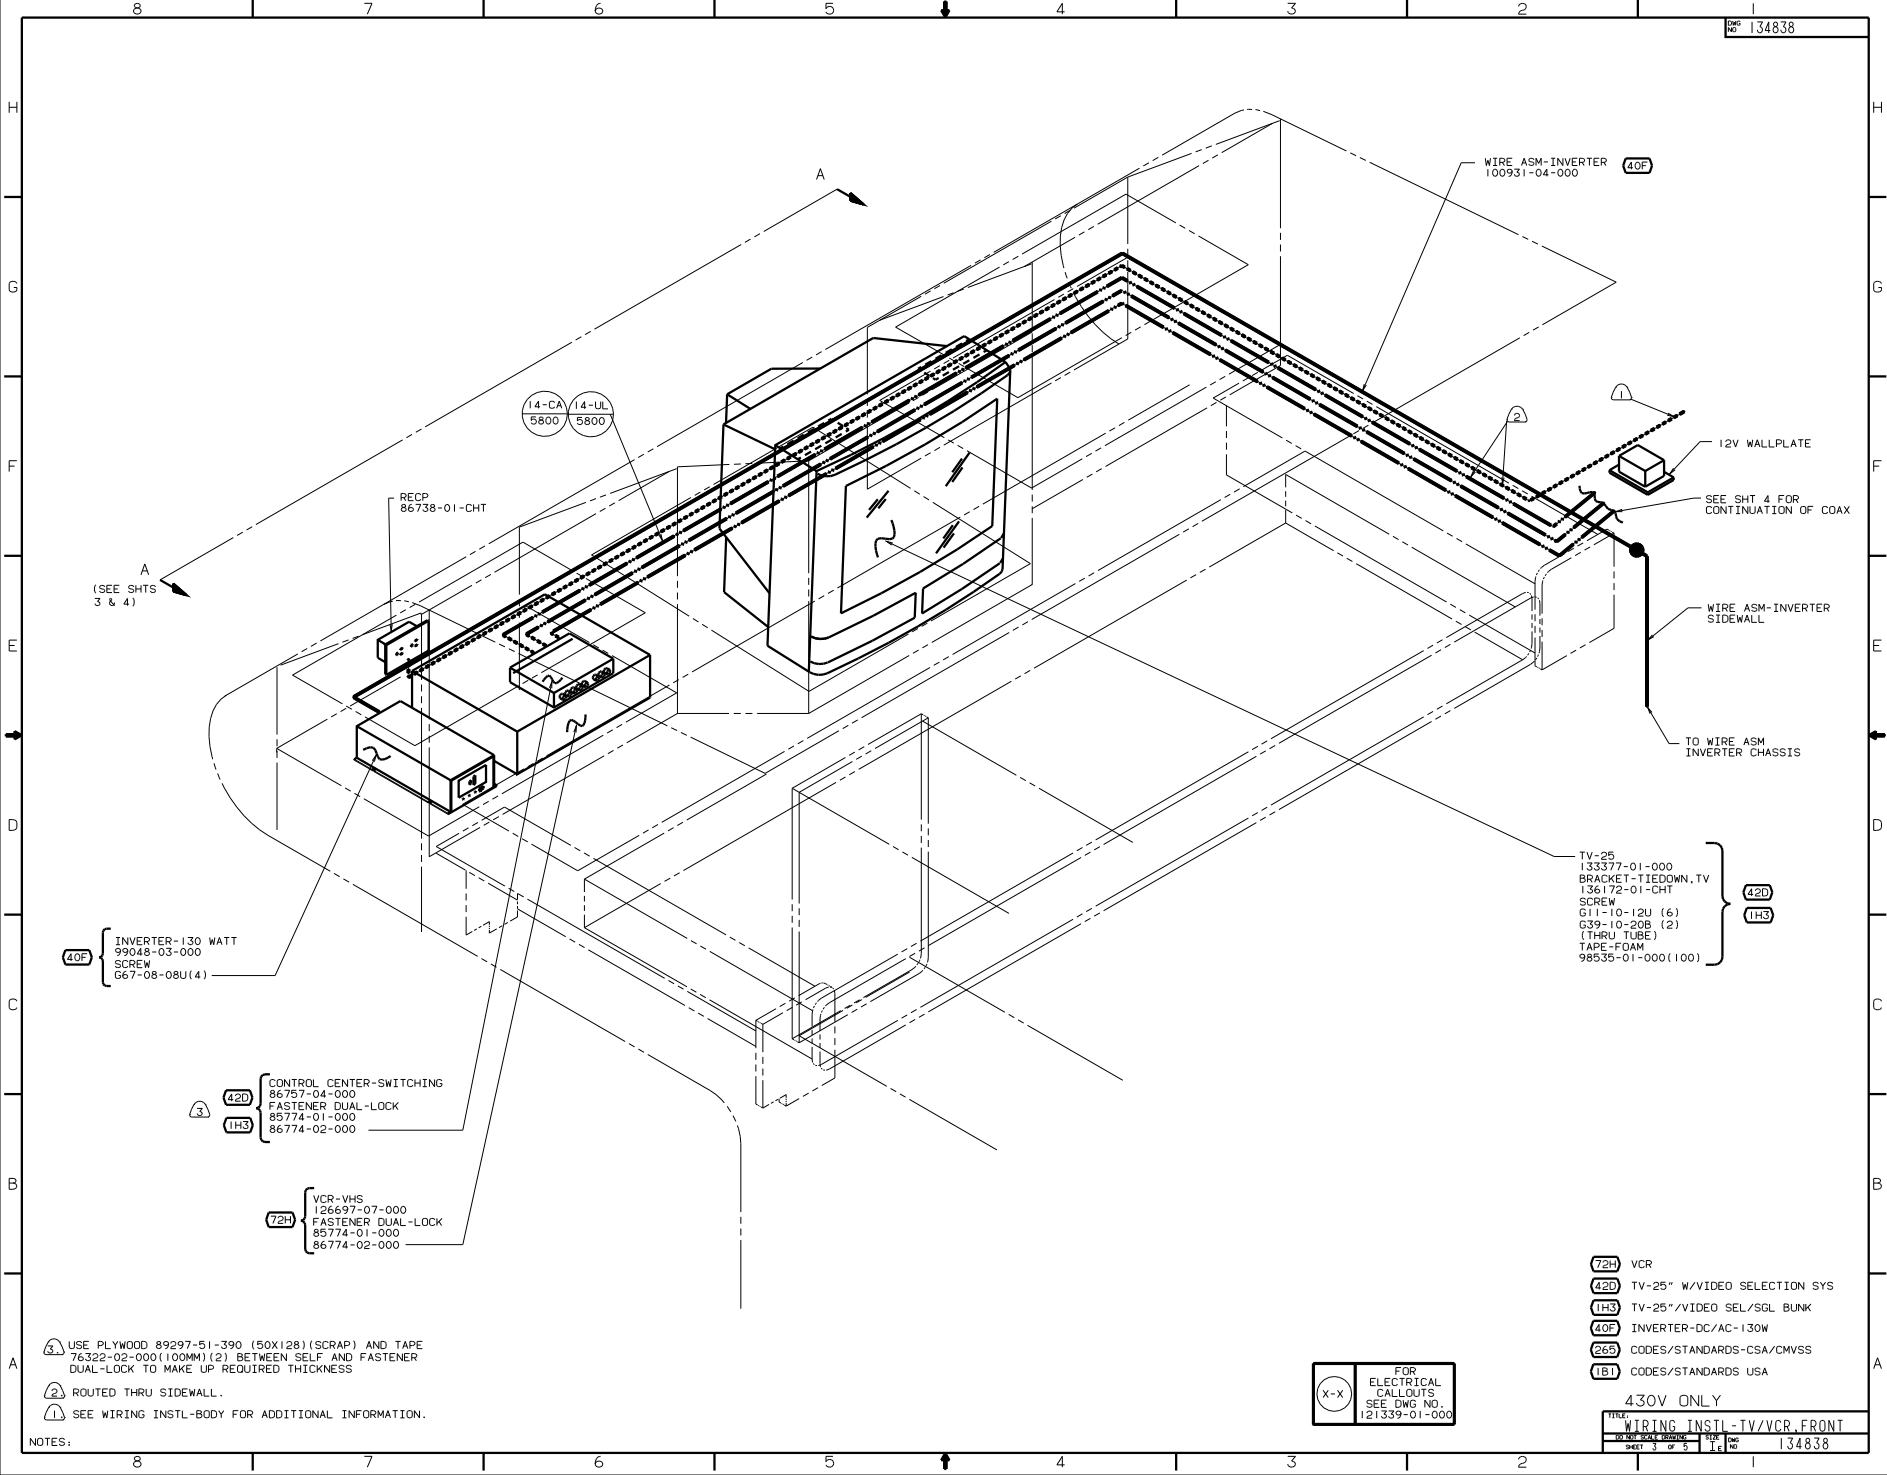

40F { INVERTER-130 WATT
99048-03-000
SCREW
667-08-08U(4)

3 { 420 CONTROL CENTER-SWITCHING
86757-04-000
FASTENER DUAL-LOCK
1H3 85774-01-000
86774-02-000

72H { VCR-VHS
126697-07-000
FASTENER DUAL-LOCK
85774-01-000
86774-02-000

TV-25
133377-01-000
BRACKET-TIEDOWN,TV
136172-01-CHT
SCREW
G11-10-12U (6)
G39-10-20B (2)
(THRU TUBE)
TAPE-FOAM
98535-01-000(100)


72H VCR
420 TV-25" W/VIDEO SELECTION SYS
1H3 TV-25"/VIDEO SEL/SQL BUNK
40F INVERTER-DC/AC-130W
260 CODES/STANDARDS-CSA/CMVSS
1B1 CODES/STANDARDS USA

430V ONLY

- NOTES:
- USE PLYWOOD 89297-51-390 (50X128) (SCRAP) AND TAPE 76322-02-000(100MM)(2) BETWEEN SELF AND FASTENER DUAL-LOCK TO MAKE UP REQUIRED THICKNESS
 - ROUTED THRU SIDEWALL.
 - SEE WIRING INSTL-BODY FOR ADDITIONAL INFORMATION.

FOR
ELECTRICAL
CALLOUTS
SEE DWG NO.
121339-01-000

WIRING INSTL-TV/VCR FRONT
SHEET 3 OF 5
134838

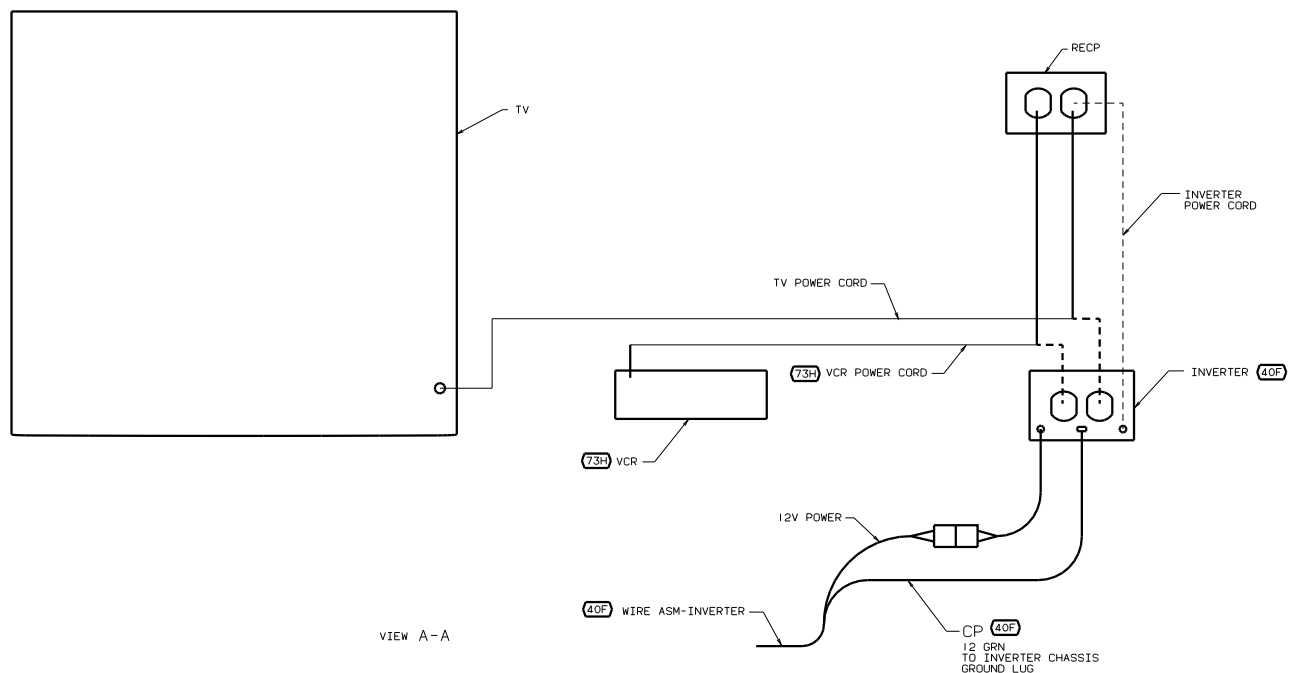


110V AND 12V

- (73H) TV-19"/VCR/VIDEO SEL/SGL BNK
- (68F) TV-19"/VIDEO SELECT/SGL BNK
- (40F) INVERTER-DC/AC-130W
- (26D) CODES/STANDARDS-CSA/CMVSS
- (1B1) CODES/STANDARDS USA

WITH (40F) PLUG TV OR (TV AND VCR) INTO INVERTER.
PLUG INVERTER INTO OVHD RECP.

NOTES:

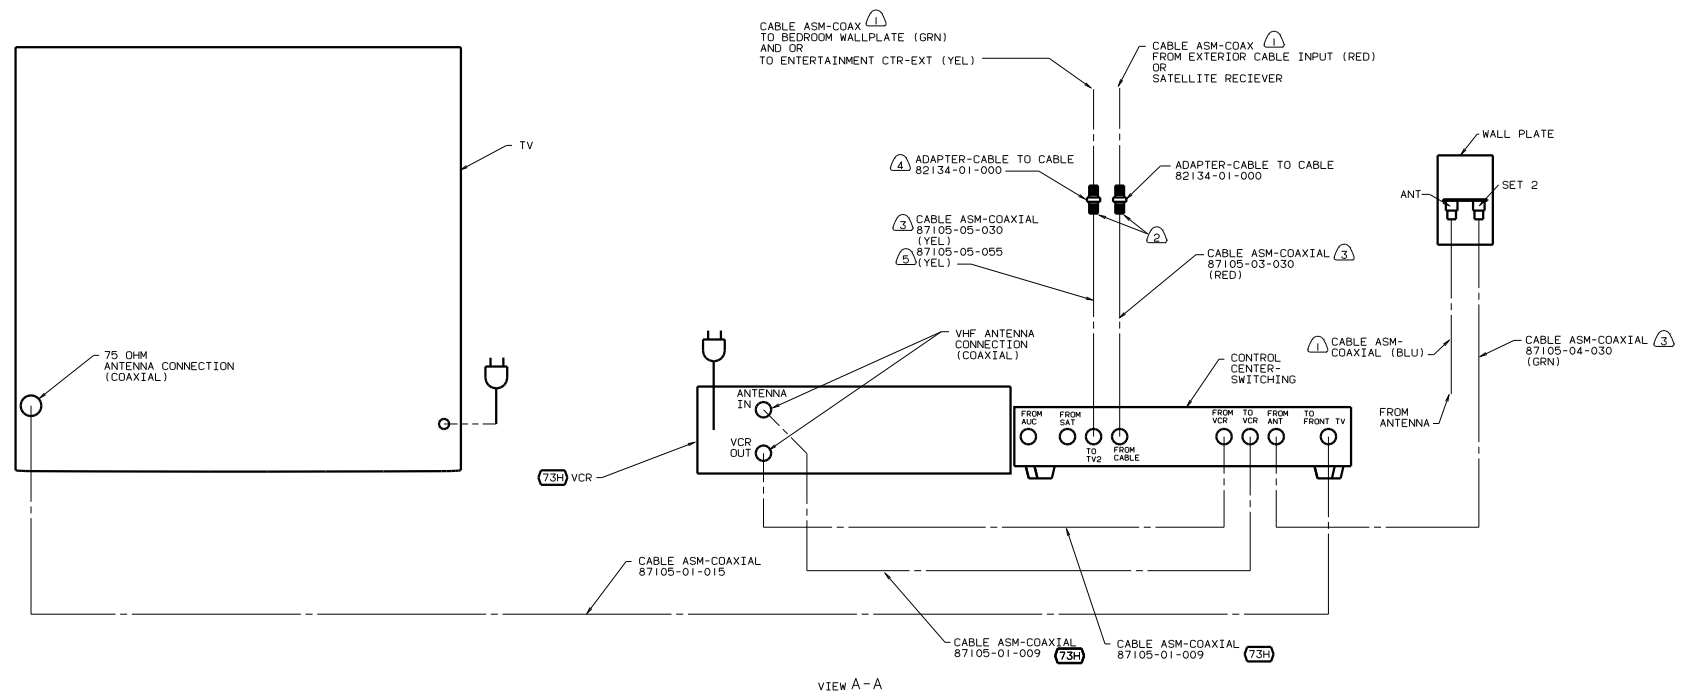

VIEW A-A

- NOTES:
- 430V ONLY.
 - SOME MODELS MAY REQUIRE REPLACING THE ADAPTER WITH A SPLITTER. SEE THE COAX CONNECTION DETAILS ON THE WIRING INSTL-BODY FOR SPECIFIC INFORMATION.
 - ROUTE THRU SIDEWALL.
 - CONNECTION LOCATED NEAR 12V WALLPLATE.
 - SEE WIRING INSTL-BODY FOR ADDITIONAL INFORMATION.

COAX	
73H	TV-19"/VCR/VIDEO SEL/SGL BNK
68F	TV-19"/VIDEO SELECT/SGL BUNK
26S	CODES/STANDARDS-CSA/CMVSS
181	CODES/STANDARDS USA