




**DANGER**

**Danger of electrical shock, burns or death.** Always remove all power sources before attempting any repair, service or diagnostic work. Power can be present from shore power, generator, inverter or battery. All power sources must be disabled and secured before performing any service.









**CAUTION**

If you lack the skills, tools or equipment to perform diagnostic or repair work leave such work to an authorized Winnebago Industries dealer or other qualified shop.

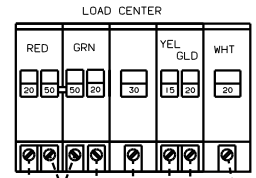


CENTRAL AIR UNIT (LOCATED IN RIGHT REAR COMPARTMENT BELOW FLOOR)

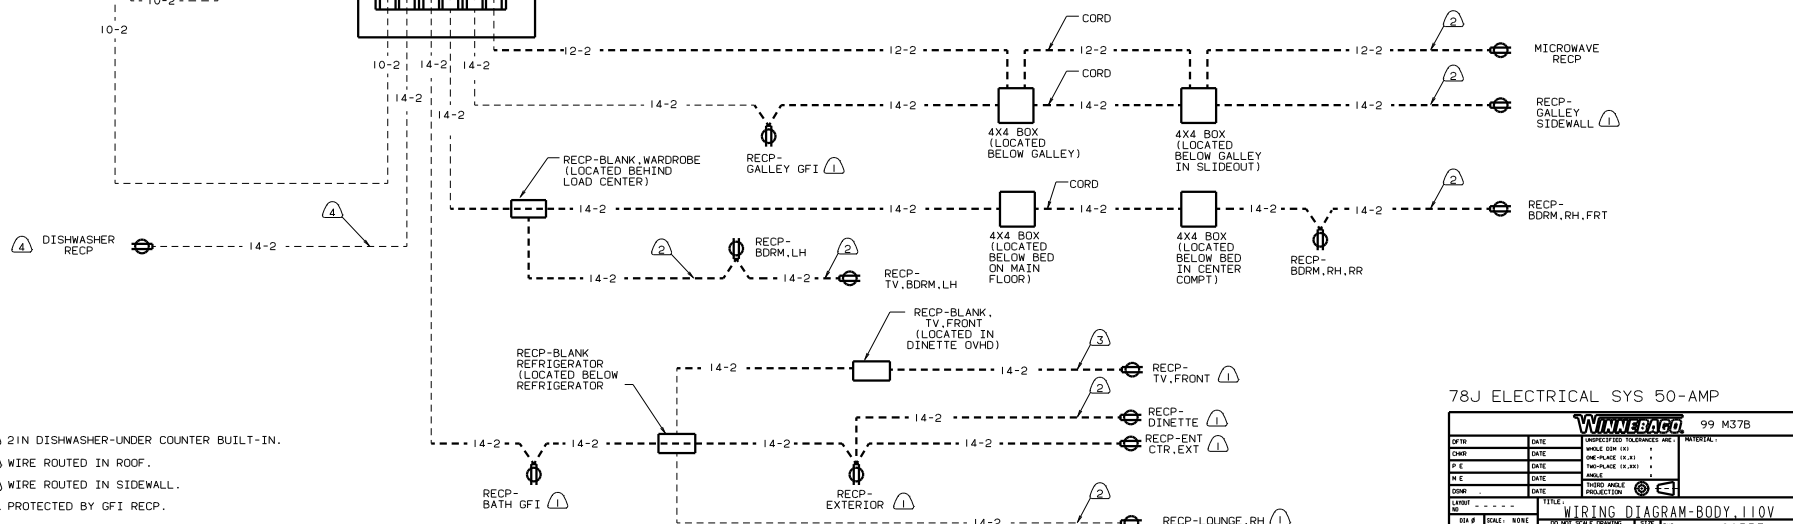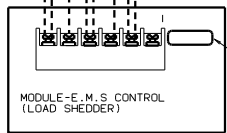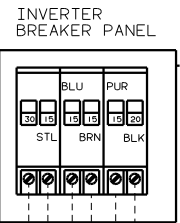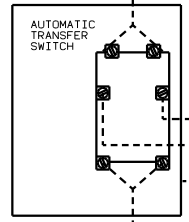





- ④ 2IN DISHWASHER-UNDER COUNTER BUILT-IN.
- ③ WIRE ROUTED IN ROOF.
- ② WIRE ROUTED IN SIDEWALL.
- ① PROTECTED BY GFI RECP.

78J ELECTRICAL SYS 50-AMP





|                                 |                            |               |
|---------------------------------|----------------------------|---------------|
| WINNEBAGO                       |                            | 99 M37B       |
| DATE                            | UNDESIGNED TOLERANCES ARE: | MATERIAL      |
| DATE                            | WHOLE DIM (IN)             |               |
| DATE                            | ONE-PLACE (IN.X1)          |               |
| DATE                            | TWO-PLACE (IN.XXX)         |               |
| DATE                            | ANGLE                      |               |
| DATE                            | INDIC. W/ANGLE             |               |
| DATE                            | PRODUCTION                 |               |
| TITLE: WIRING DIAGRAM-BODY 110V |                            |               |
| REV #                           | SCALE                      | NO. OF SHEETS |
| 1                               | 1:1                        | 2             |
| SHEET 1 OF 2                    |                            | 128553        |

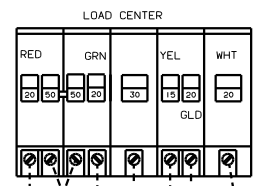





CENTRAL AIR UNIT  
(LOCATED IN RIGHT REAR COMPARTMENT BELOW FLOOR)

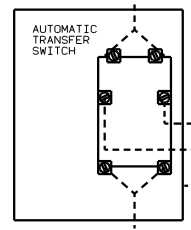

INVERTER BREAKER PANEL

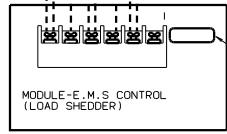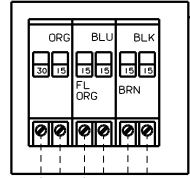

- MICROWAVE RECP
- RECP-GALLEY SIDEWALL APPLIANCE
- RECP-DINETTE APPLIANCE

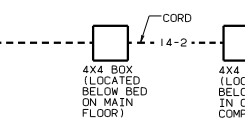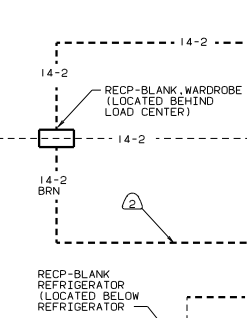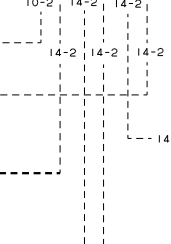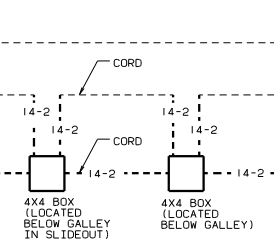

- RECP-BDRM, RH, FRT
- RECP-GALLEY GFI
- RECP-BDRM, RH, RR
- RECP-BDRM, LH
- RECP-TV, BDRM, LH
- RECP-LOUNGE, RH
- RECP-ENT CTR, EXT
- RECP-TV, FRONT
- RECP-BLANK TV, FRONT (LOCATED IN DINETTE OVHD)
- RECP-EXTERIOR

- 4) 54E WASHER/DRYER COMBINATION.
- 3) WIRE ROUTED IN ROOF.
- 2) WIRE ROUTED IN SIDEWALL.
- 1) PROTECTED BY GFI RECP.